

MAJ系列

MAJ - **60** - **10** - **V2**

↓ ↓ ↓ ↓

減速機款式 規格 減速比選定 馬達類型




MODEL	1段	2段
42	3,4,5,7,10	15,20,25,30,35
60		40,50,70,100
90		

V1: 伺服Ø8 PCD45,M3 V2: 伺服Ø8 PCD46,M4	T1: 步進Ø5 PCD43.8,M3 T2: 步進Ø6 PCD43.8,M3
各廠牌100W AC 伺服馬達	各廠牌42型步進馬達

V1: 伺服Ø14 PCD70,M4 V2: 伺服Ø14 PCD70,M5	T1: 步進Ø8 PCD66.67,M4 T2: 步進Ø8 PCD70,M4 T3: 步進Ø10 PCD70,M4
各廠牌200~400W AC 伺服馬達	各廠牌60型步進馬達

V1: 伺服Ø19 PCD90,M5 V2: 伺服Ø19 PCD90,M6	T1: 步進Ø14 PCD98.4,M5
各廠牌750W AC 伺服馬達	各廠牌86型步進馬達

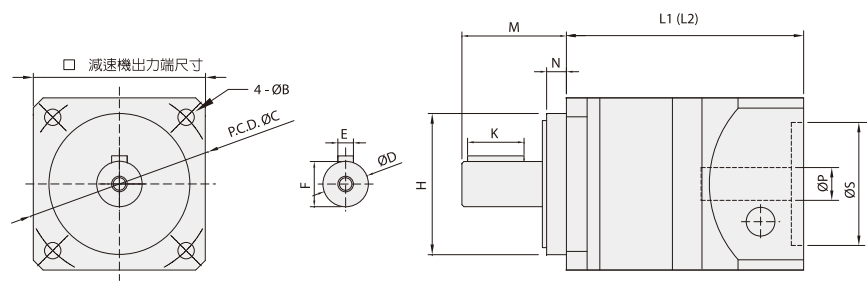

型號	尺寸	A	B	C	D	E	F	K	H	L1	L2	M	N	S	P	入力端螺絲孔
MAJ42		42	3.2	50	13	5	15	15	35	58	74	26	3	30	≦ 8	PCD46,M4
MAJ60		60	5.5	70	16	5	18.5	20	50	78	102	34	7.5	50	≦ 14	PCD70,M5
MAJ90		90	7	100	22	6	24.5	25	80	97	127.5	45	5	70	≦ 19	PCD90,M6
MAJ120		120	9	130	32	10	35	40	110	133	158	58	5	110	≦ 24	PCD145,M8